

Facility: City Landfill

Address: 5700 Peabody Road Date of Survey: 07/01/11



1 ACCESS TO THE SITE AND/OR FACILITY


1.1 Exterior Accessible Route (sidewalks, paths, etc.)

- Refer to building plan included with this report: (A) Increase the size of the existing level concrete landing (shown in blue ink in sketch on next page) at the south entry door into the Landfill Operation Center (see photo 1 below) to obtain the ADAAG required wheelchair clearances at the door with a larger landing (shown in red ink in the sketch on the next page).

Estimated Cost: 1,458.00



Photo 1

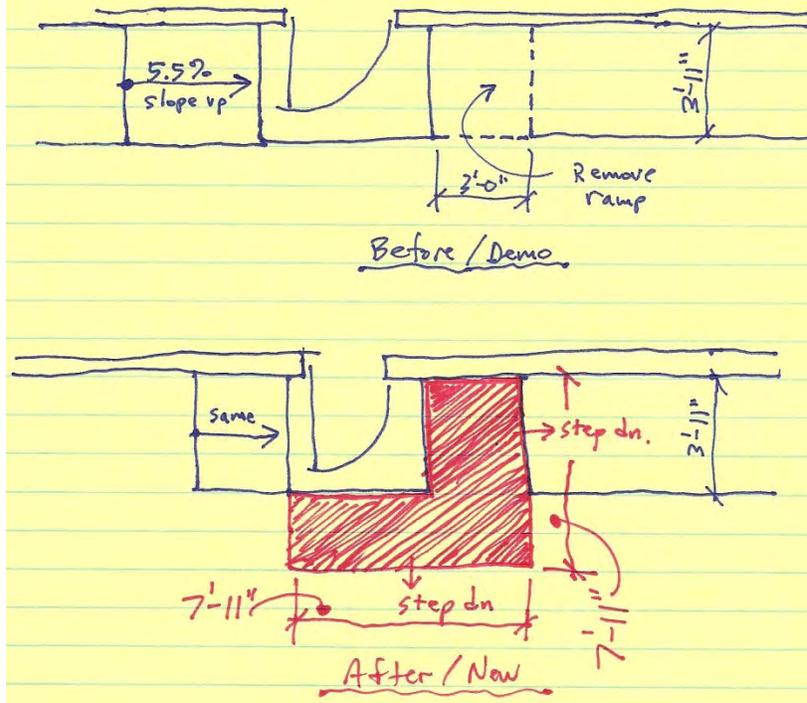

1.2 Parking

- Refer to building plan included with this report: (1) Existing ADA parking space slopes at the Landfill Operation Center are acceptable, but the space needs to be paint striped (blue paint) so that the parking spaces in min. 8' wide and the adjacent access aisle is min. 8' wide to allow for van access. Also add a van access sign to the existing ADA parking sign. **Estimated Cost: \$132.00**
- Refer to building plan included with this report: (2) Existing ADA parking space slopes at the Material Recovery Facility are up to 4% and spaces are not properly striped. Repave area for max. slopes of 2% and paint stripe (blue paint) the repaved spaces so that the one ADA parking space is min. 8' wide and the adjacent access aisle is min. 8' wide to allow for van access. Also add a van access sign to the existing ADA parking sign. **Estimated Cost: \$1,444.00**

1.3 Curb Cuts & Curb Ramps

- No curb ramps located at the buildings.

1.4 Exterior Ramps

- None exist.

1.5 Exterior Stairs

- None exist.

2 SERVICES

2.1 Building Entrances (exterior doors)

- No work.

2.2 Interior Accessible Route

- No work.

2.3 Interior Ramps

- None exist.

2.4 Interior Stairs

- No work.

2.5 Elevators

- None exist.

2.6 Platform (wheelchair) Lifts

- None exist.

2.7 Doors (interior, excluding restroom doors addressed in 3.1 and non-public area doors)

- No work.

2.8 Places of Assembly (auditoriums, meeting rooms, gymnasiums, etc.)

- No work.

2.9 Seating and Tables

- No work.

2.10 Restaurant (includes dining areas, snack bars, vending areas & public use kitchens)

- Not applicable.

2.11 NOT USED

2.12 Business & Mercantile (public & administration areas)

- Refer to the building plan included with this report: (B) Install some type of sliding tray at the weigh station/pay booth for access from vehicles (see photo 2 below and example of sliding transaction tray included with this report).

Estimated Cost: \$1,825.00



Photo 2

2.13 Dressing and Fitting Rooms

- Not applicable.

2.14 NOT USED

2.15 NOT USED

2.16 Libraries

- Not applicable.

2.17 Storage

- No work.

3 ACCESS TO PUBLIC AMENITIES

3.1 Drinking Fountains

- No work.

3.2 Restrooms

- Refer to building plan included with this report: (C) Public-Use Unisex Restroom in the Landfill Operation Center: Move the bench in the corridor that blocks proper wheelchair clearance at the restroom door (see photo 3 below), install a braille/tactile ADA restroom sign on the latch side of the door and mounted to be 60” from floor to centerline of the sign, fur out wall with a half wall to get to 18” from the side wall to the centerline of the toilet fixture, replace the lavatory with a lavatory that meets the requirements of ADAAG 4.19, install a mirror with low reflective surface no higher than 40” a.f.f., relocate the paper towel dispenser so that it is wheelchair accessible and no higher than 48” a.f.f. and install rear and side grab bars to meet ADAAG 4.16.4. **Cost Estimate: \$3,574.00**



Photo 3

3.3 Signage

- Included in Section 3.2 above.

3.4 Bathtub & Showers (including locker rooms and dressing rooms)

- Not applicable.

4 BARRIER REMOVAL - OTHER

4.1 Alarms

- No work.

4.2 Public Telephones

- None exist.

4.3 Protruding Objects

- None identified.

4.4 Work Areas

- No work.

4.5 Sinks, Other than Lavatories

- No work.


5 COST ESTIMATE

5.1 Cost Estimate & Notes

- Total facility cost estimate for recommended ADA modifications: **\$8,433.00**



Rough Opening: 15-1/4" (W) X 6-3/8" (H)
Actual Dimension 14-7/8" (W) X 6" (H)

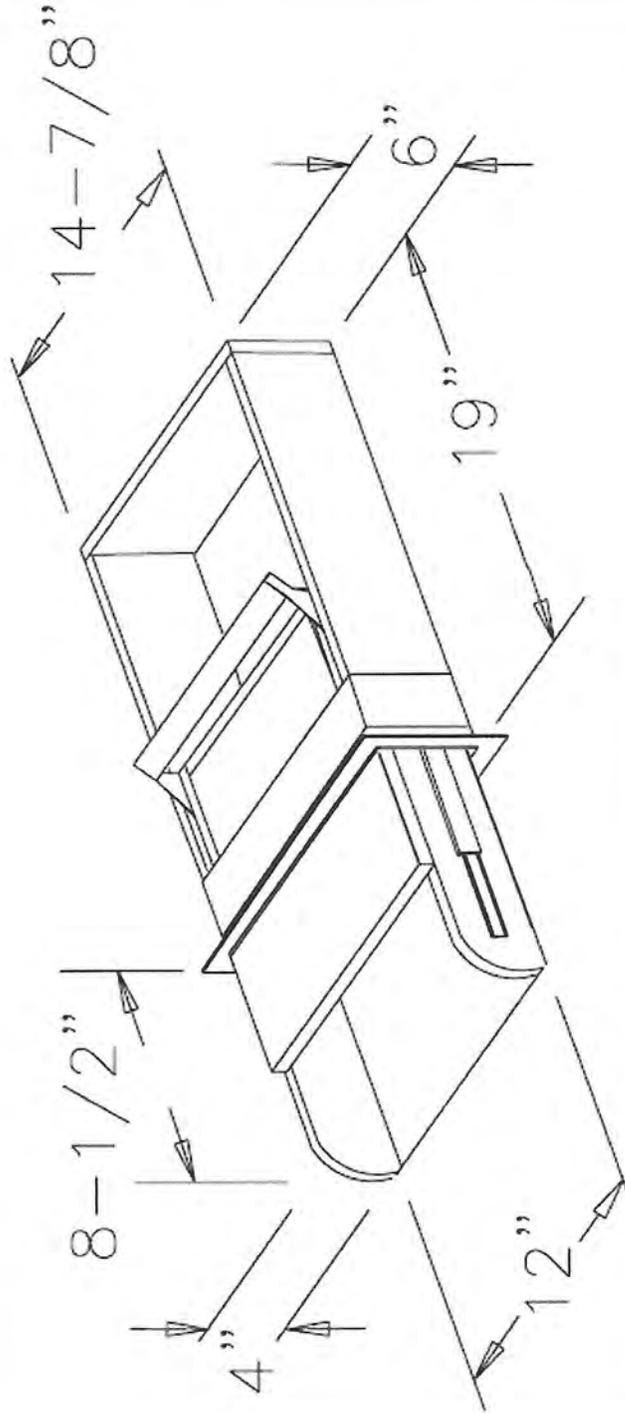

NOTE: THIS DRAWING EMBODIES A CONFIDENTIAL PROPRIETARY DESIGN ORIGINATED AND OWNED BY QLIKSEY CORP., AND IS SUBMITTED UNDER A CONFIDENTIAL RELATIONSHIP. ALL PATENT, MANUFACTURING, SALE RIGHTS REGARDING THE SAME ARE RESERVED EXCEPT TO THE EXTENT RIGHTS ARE EXPRESSLY GRANTED TO OTHERS. THE RECIPIENT AGREES BY ACCEPTING THESE DRAWINGS NOT TO SUPPLY OR DISCLOSE ANY INFORMATION REGARDING THEM TO ANY UNAUTHORIZED PERSON.

Interbank-Exchange, LLC
P. O. Box 632
Black Canyon City, AZ

QST-619-DT MAIN VIEW
Submitted By: BRIAN COBLE
Date: 12/23/2005
Sheet: DD26

This Page Intentionally Left Blank