

# Facility: Orr St. Fire Station & Administration

Address: 201 Orr Street

Date of Survey: 05/14/10



## 1 ACCESS TO THE SITE AND/OR FACILITY

### 1.1 Exterior Accessible Route (sidewalks, paths, etc.)

- Refer to site plan included with this report: (A) Fill/patch 1" wide gap between accessible parking spaces and sidewalk (see photo 1 next page).

**Estimated Cost: \$100.00**

### 1.2 Parking

- No work.

### 1.3 Curb Cuts & Curb Ramps

- No curb ramps located at the building. Curb ramps located at nearby street intersections have not been evaluated as part of this survey and are being addressed in a separate City sponsored project dealing with Right-of-Way issues.



Photo 1

#### **1.4 Exterior Ramps**

- None exist.

#### **1.5 Exterior Stairs**

- None exist.

## **2 SERVICES**

#### **2.1 Building Entrances (exterior doors)**

- No work.

#### **2.2 Interior Accessible Route**

- No work.

#### **2.3 Interior Ramps**

- None exist.

#### **2.4 Interior Stairs**

- None exist.

## **2.5 Elevators**

- None exist.

## **2.6 Platform (wheelchair) Lifts**

- None exist.

## **2.7 Doors (interior, excluding restroom doors addressed in 3.1 and non-public area doors)**

- Refer to building plan included with this report: (B) Adjust the closers on three doors so that they open with 5 lbs. of force or less.

**Estimated Cost: \$60.00**

## **2.8 Places of Assembly (auditoriums, meeting rooms, gymnasiums, etc.)**

- Not applicable.

## **2.9 Seating and Tables**

- Not applicable.

## **2.10 Restaurant (includes dining areas, snack bars, vending areas & public use kitchens)**

- Not applicable.

## **2.11 NOT USED**

## **2.12 Business & Mercantile (public & administration areas)**

- Not applicable.

## **2.13 Dressing and Fitting Rooms**

- Not applicable.

## **2.14 NOT USED**

## **2.15 NOT USED**

## **2.16 Libraries**

- None exist.

## **2.17 Storage**

- No work.

### **3 ACCESS TO PUBLIC AMENITIES**

#### **3.1 Drinking Fountains**

- No work.

#### **3.2 Restrooms**

- Refer to building plan included with this report: (C) Men's Public Restroom: Install a braille/tactile ADA restroom sign on the latch side of the door mounted at 60" from the floor to the centerline of the sign, lower the mirror so that the lowest reflective surface is no higher than 40" a.f.f. and lower the paper towel dispenser so that the highest operable part of the dispenser is no higher than 48" a.f.f.

**Estimated Cost: \$104.00**

- Refer to building plan included with this report: (D) Women's Public Restroom: Install a braille/tactile ADA restroom sign on the latch side of the door mounted at 60" from the floor to the centerline of the sign, lower the mirror so that the lowest reflective surface is no higher than 40" a.f.f. and replace the 30" long rear grab bar with the ADAAG min. required 36" long grab bar.

**Estimated Cost: \$214.00**

#### **3.3 Signage**

- Included in Section 3.2 above.

#### **3.4 Bathtub & Showers (including locker rooms and dressing rooms)**

- No work.

### **4 BARRIER REMOVAL - OTHER**

#### **4.1 Alarms**

- No work.

#### **4.2 Public Telephones**

- None exist.

#### **4.3 Protruding Objects**

- None exist.

#### **4.4 Work Areas**

- No work.

#### **4.5 Sinks, Other than Lavatories**

- No work.

### **5 COST ESTIMATE**

#### **5.1 Cost Estimate & Notes**

- Total facility cost estimate for recommended ADA modifications: **\$478.00**

FACILITY SUMMARY		NAME: ORR ST. FIRE STATION / ADMIN.
SECTION HEADING	COST	COMMENTS

**1 Access to the Facility**

1.1 Exterior Accessible Route	100.00	Fill 1" w gap in sidewalk @ ADA parking
1.2 Parking	-	
1.3 Curb Ramps	-	
1.4 Exterior Ramps	-	
1.5 Exterior Stairs	-	

**2 Services**

2.1 Building Entrances	-	
2.2 Interior Accessible Route	-	
2.3 Interior Ramps	-	
2.4 Interior Stairs	-	
2.5 Elevators	-	
2.6 Platform Lifts	-	
2.7 Doors	60.00	Adjust 3 door closers
2.8 Places of Assembly	-	
2.9 Seating and Tables	-	
2.10 Restaurant	-	
2.11 NOT USED	-	
2.12 Business and Mercantile	-	
2.13 Dressing and Fitting Rooms	-	
2.14 NOT USED	-	
2.15 NOT USED	-	
2.16 Libraries	-	
2.17 Storage	-	

**3 Access to Public Amenities**


3.1 Drinking Fountains	-	
3.2 Toilet Rooms	318.00	Modifications @ two restrooms
3.3 Signage	-	
3.4 Bathtubs and Showers	-	



**4 Barrier Removal - Other**

4.1 Alarms	-	
4.2 Public Telephones	-	
4.3 Protruding Objects	-	
4.4 Work Areas	-	
4.5 Sinks, Other than Lavatories	-	

<b>Total Barrier Removal Cost</b>	<b>478.00</b>	
-----------------------------------	---------------	--

ORR ST. FIRE STATION / ADMINISTRATION 

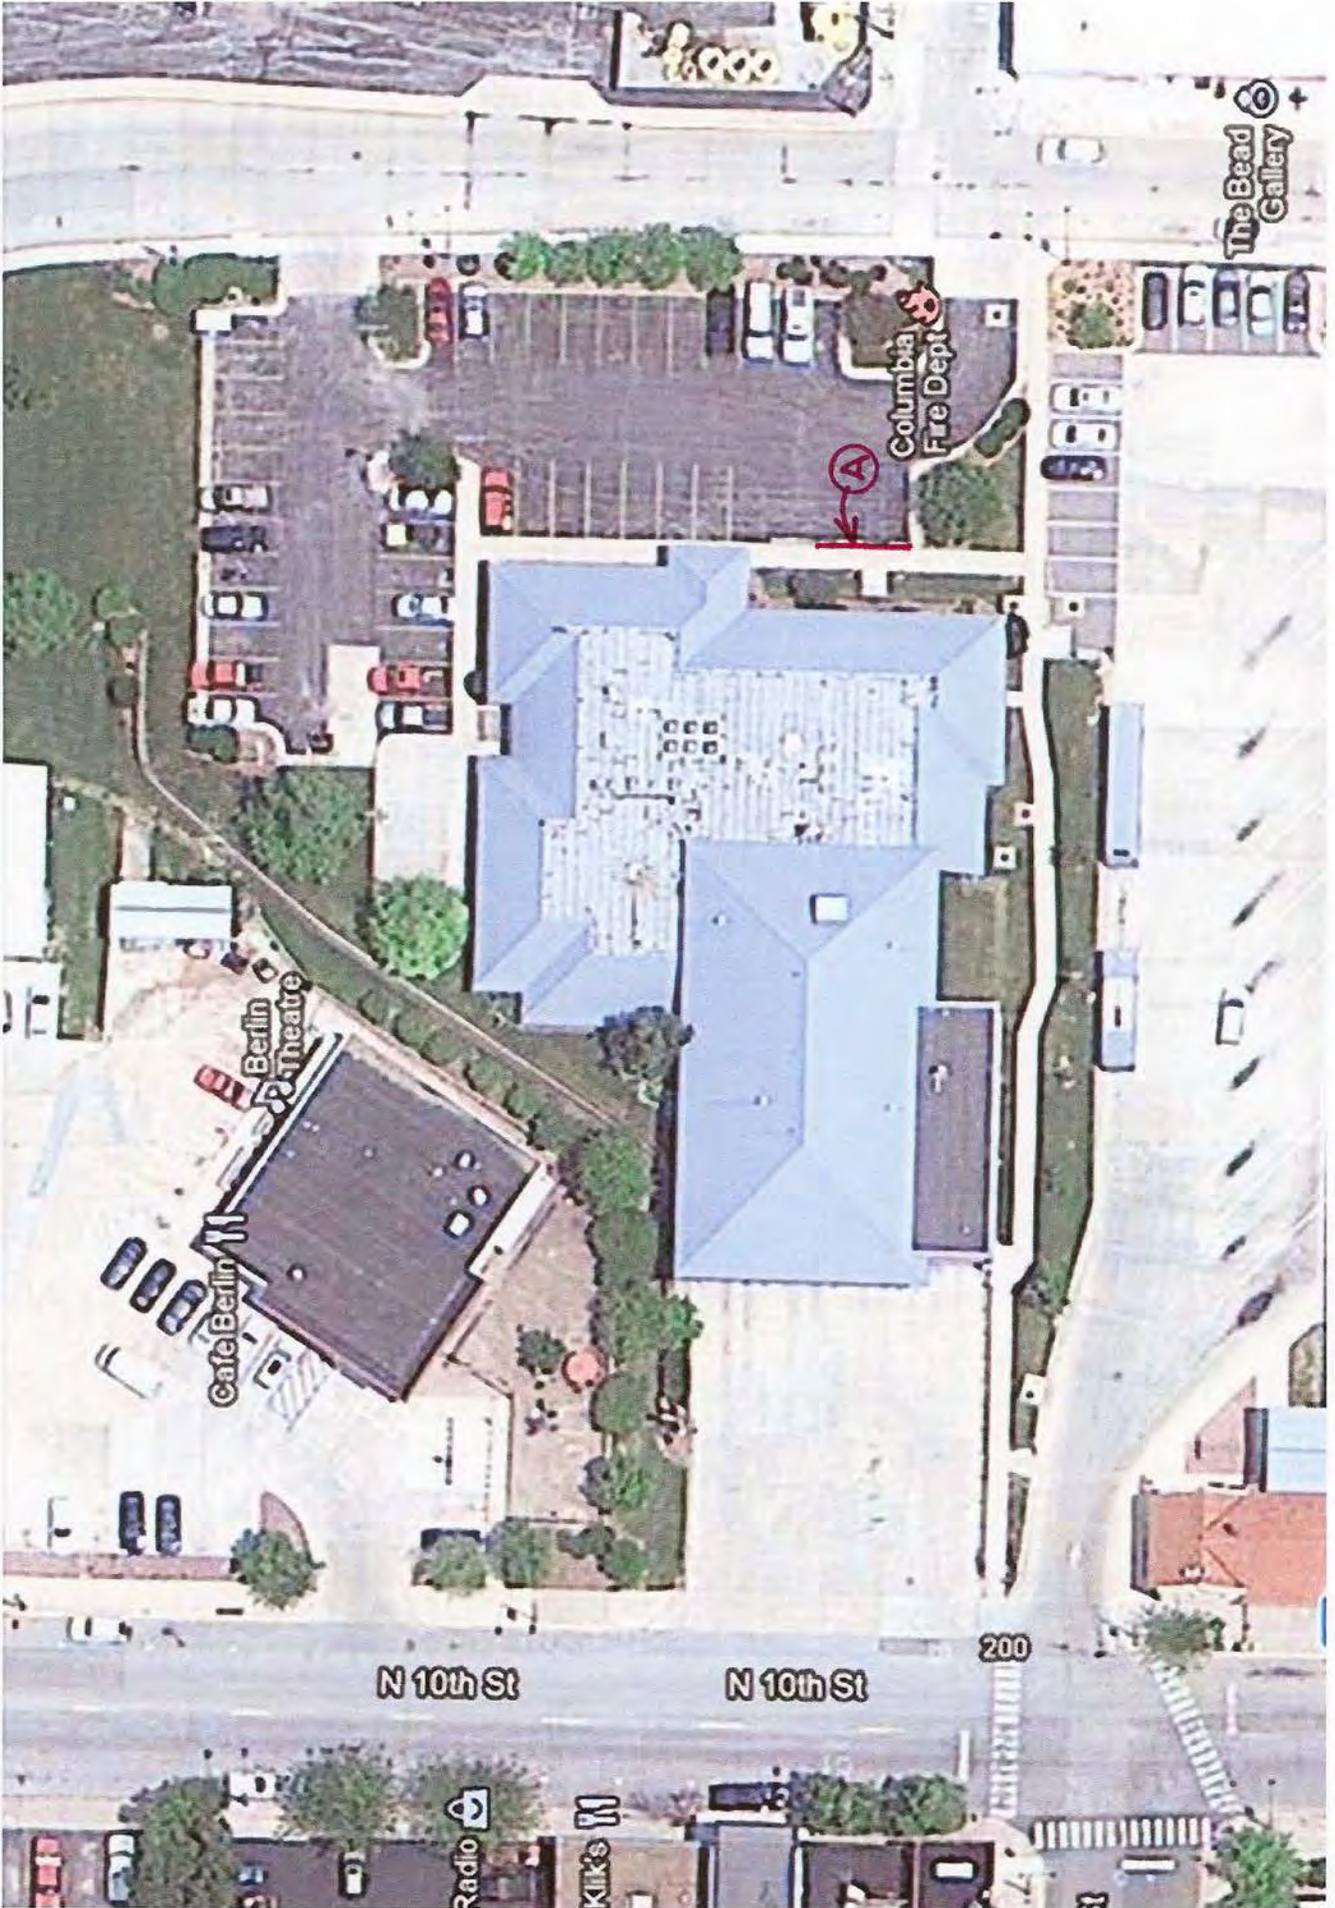

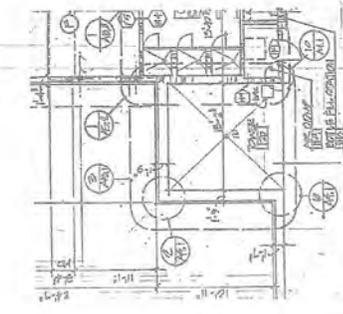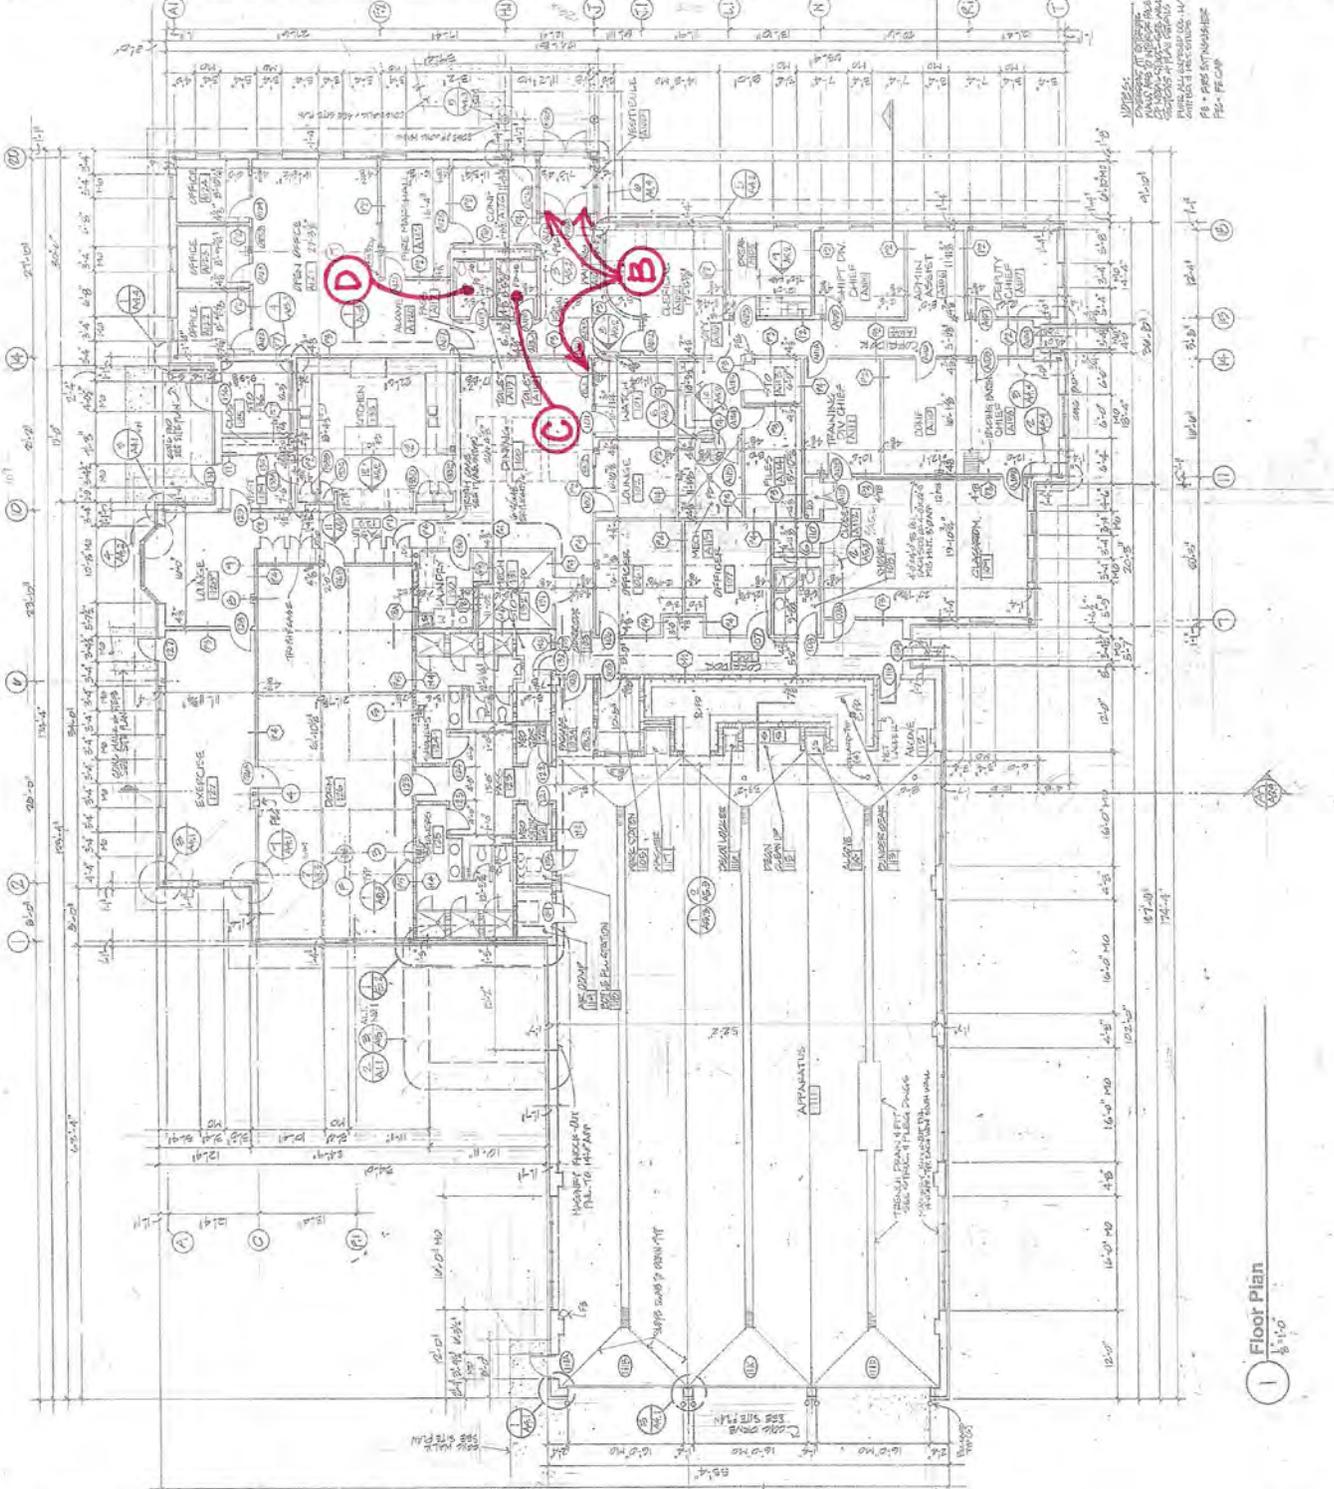

**2. Floor Plan - Alternate**  
HOSE WARE ACTUAL

**1. Floor Plan**  
1" = 1'-0"